

DATOS TÉCNICOS: ELEMENTOS NECESARIOS PARA EL CALCULO DE UNA TRANSMISION

TABLA 2: ELECCION DE LA SECCION DE CORREA

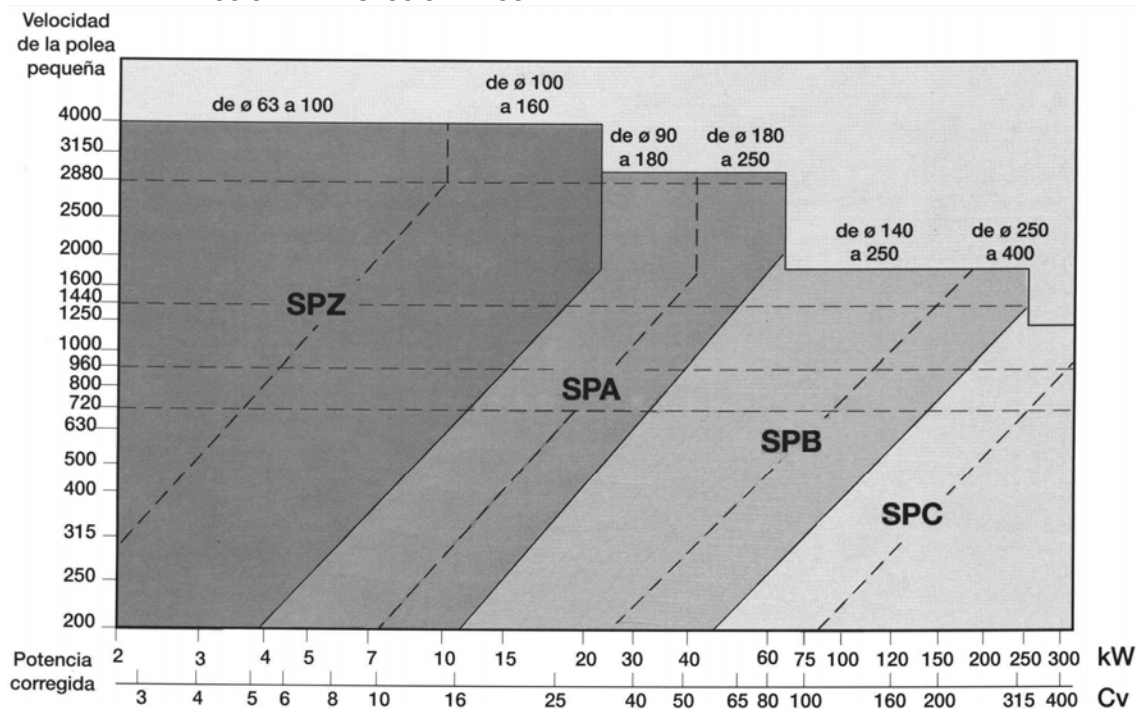


TABLA 4: FACTOR LONGITUD

SECCION SPZ/Z		SECCION SPA/A		SECCION SPB/B		SECCION SPC/C/D	
Long prim. de - a	Coef.	Long prim. de - a	Coef.	Long prim. de - a	Coef.	Long prim. de - a	Coef.
0,630 a 0,710	0,80	0,800 a 0,950	0,80	1,250 a 1,400	0,80	2,240 a 2,360	0,80
0,750 a 0,950	0,85	1,000 a 1,250	0,85	1,500 a 1,900	0,85	2,500 a 3,000	0,85
1,000 a 1,250	0,90	1,320 a 1,700	0,90	2,000 a 2,500	0,90	3,150 a 4,000	0,90
1,320 a 1,500	0,95	1,800 a 2,360	0,95	2,650 a 3,350	0,95	4,250 a 5,300	0,95
1,600 a 2,120	1,00	2,500 a 3,150	1,00	3,550 a 4,500	1,00	5,600 a 7,100	1,00
2,240 a 2,800	1,05	3,350 a 4,000	1,05	4,750 a 5,300	1,05	7,500 a 9,500	1,05
3,000 a 3,750	1,10					10,000 a 12,500	1,10

TABLA 5: FACTOR ANGULAR

D-d E	0,00	0,10	0,20	0,30	0,40	0,50	0,60	0,70	0,80	0,90	1	1,10	1,20	1,30	1,40	1,50
2 poleas trapeziales	1,00	0,99	0,97	0,96	0,94	0,92	0,90	0,88	0,87	0,85	0,83	0,80	0,78	0,75	0,72	0,69
Poleas planas	0,74	0,76	0,77	0,79	0,80	0,82	0,83	0,84	0,86	0,85	0,82	0,80	0,77	0,75	0,72	0,69



WEDA TRANSMISIONES S.L.